

KE 1000

ACTIVE
SAFETY

OSAS



USAS



OPAS



SKUDO

Il nuovo codice sarà fornito solo ad esaurimento del vecchio

The new code will be supplied only when the old will be out of stock

Der neue Kode wird geliefert nur wenn der alte nicht mehr im Lager ist

Le nouveau code sera fourni uniquement lorsque le vieux stock sera écoulé

El nuevo código será suministrado sólo cuando el viejo está fuera de stock


O novo código irá ser fornecido apenas quando o antigo esgotar stock

* F_{1i} =

Isothermal
end force
at 100% Cu



** F_{1p} =

Polytrophic
end force
at 100% Cu

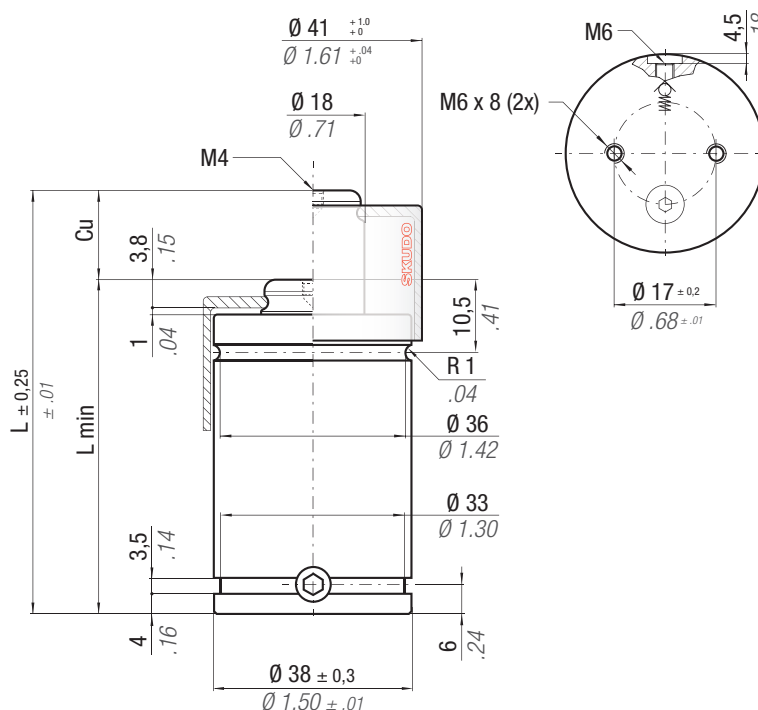

 N2		°F 32 176	 °C 0 80	ΔP ± 0,33 %/°C	P max 150 bar 2175 psi	P min 20 bar 290 psi	S 7,07 cm² 1.096 in²	SPM ~ 50 - 100 (at 20°C)	Max Speed 0,8 m/s	Maintenance kit 39BMKE01000B								
CODE PHASING OUT from 08/2012	 NEW	Cu		L		L min		F0 Initial force		F1i * End force *		F1p ** End force **		Vo				
		mm	inch	mm	inch	mm	inch	daN	lb	daN	lb	daN	lb	cm³	in³	~Kg	~lb	2014/68/EU
KE 1000 - 006 - A	◆ KE 1000 - 006 - B	6	0.24	61	2.40	55	2.17	1060 2383 ± 5%		1902	4277	2412	5422	11,0	0.67	0,33	0.72	✓
KE 1000 - 010 - A	KE 1000 - 010 - B	10	0.39	78	3.07	68	2.68			1834	4123	2297	5164	19,0	1.16	0,38	0.84	✓
KE 1000 - 016 - A	KE 1000 - 016 - B	16	0.63	100	3.94	84	3.31			1814	4078	2264	5090	31,0	1.89	0,44	0.97	✓
KE 1000 - 025 - A	KE 1000 - 025 - B	25	0.98	135	5.31	110	4.33	150 bar 2175psi		1769	3977	2190	4923	51,0	3.11	0,53	1.17	✓
KE 1000 - 032 - A	KE 1000 - 032 - B	32	1.26	167	6.57	135	5.31			1701	3824	2079	4674	69,0	4.21	0,63	1.39	✓
KE 1000 - 040 - A	KE 1000 - 040 - B	40	1.57	195	7.68	155	6.10			1727	3883	2121	4768	84,0	5.12	0,70	1.54	✓
KE 1000 - 050 - A	KE 1000 - 050 - B	50	1.97	230	9.06	180	7.09	+ 20 °C +68 °F		1750	3934	2159	4854	103,0	6.28	0,79	1.74	✓

◆ Disposable

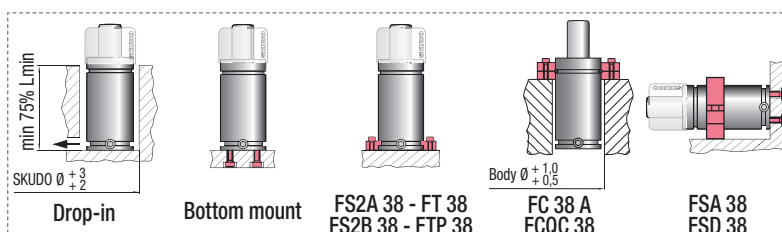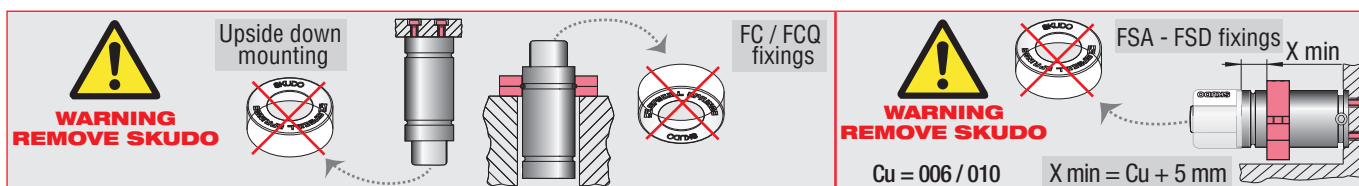

HOW TO ORDER



INSTALLATION GUIDELINE

