
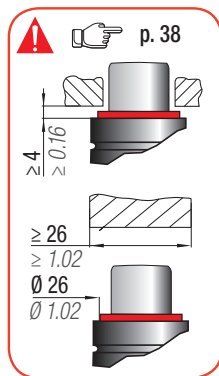


W-DX35-80-40 (Ford)

M 300

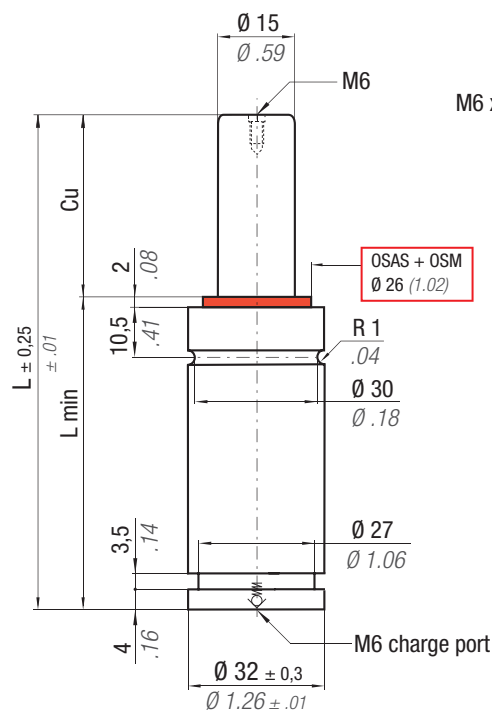

OSAS + OSM = OVER STROKE ACTIVE SAFETY + OVER STROKE MARKER

* F_{1i} =

Isothermal end force at 100% Cu



p. 18

** F_{1p} =

Polytrophic end force at 100% Cu



Collegabile con tubi
Linkable with hoses
Anschlussfähig mit Leitungen
Connectable avec tubes
Conectable con tubos
Acompláveis com tubos

Micro 32°



SW

ACTIVE SAFETY




OSAS



USAS

Force color code	P		F ₀	
	bar	psi	Initial force ± 5% at +20°C +68°F	
			daN	lb
GR	45	653	80	180
BU	90	1305	160	360
RD	135	1958	240	540
YW	180	2610	320	719
BK	10-180	145-2610	18-320	40-719

 N ₂		°F 32 176	°C 0 80	ΔP ± 0,33 %/°C	P max 180 bar 2610 psi	P min 10 bar 145 psi	S 1,77 cm ² 0.274 in ²	SPM ~ 50 - 80 (at 20°C)	Max Speed 1,8 m/s	Maintenance kit 39BMMCI32A						
CODE		C _u		L		L min		F _{1i} * End force *		F _{1p} ** End force **		V ₀				 2014/68/EU
		mm	inch	mm	inch	mm	inch	daN	lb	daN	lb	cm ³	in ³	~Kg	~lb	
M300 - 007 - A - ...		7	0.28	56	2.20	49	1.93	1,17 x F ₀		1,30 x F ₀		-	-	0,21	0.01	✓
M300 - 010 - A - ...		10	0.39	62	2.44	52	2.05	1,21 x F ₀		1,37 x F ₀		-	-	0,22	0.01	✓
M300 - 013 - A - ...		12,7	0.50	67,4	2.65	54,7	2.15	1,24 x F ₀		1,41 x F ₀		-	-	0,23	0.01	✓
M300 - 015 - A - ...		15	0.59	72	2.83	57	2.24	1,26 x F ₀		1,44 x F ₀		-	-	0,24	0.01	✓
M300 - 025 - A - ...		25	0.98	92	3.62	67	2.64	1,32 x F ₀		1,53 x F ₀		-	-	0,26	0.01	✓
M300 - 038 - A - ...		38	1.50	118	4.65	80	3.15	1,36 x F ₀		1,60 x F ₀		-	-	0,30	0.01	✓
M300 - 050 - A - ...		50	1.97	142	5.59	92	3.62	1,38 x F ₀		1,64 x F ₀		-	-	0,34	0.01	✓
M300 - 063 - A - ...		63,5	2.50	172	6.77	108,5	4.27	1,38 x F ₀		1,63 x F ₀		-	-	0,39	0.02	✓
M300 - 080 - A - ...		80	3.15	205	8.07	125	4.92	1,40 x F ₀		1,66 x F ₀		-	-	0,44	0.02	✓
M300 - 100 - A - ...		100	3.94	245	9.65	145	5.71	1,41 x F ₀		1,68 x F ₀		-	-	0,50	0.02	✓
M300 - 125 - A - ...		125	4.92	295	11.61	170	6.69	1,42 x F ₀		1,70 x F ₀		-	-	0,57	0.02	✓

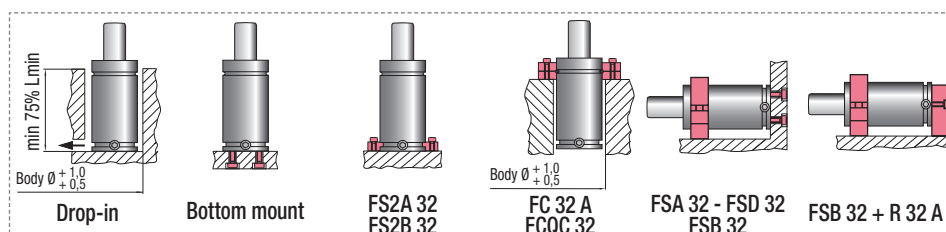

HOW TO ORDER



INSTALLATION GUIDELINE

