

RF 1200
 linkable G1/8"


SW

OSAS + OSM = OVER STROKE
ACTIVE SAFETY + OVER
STROKE MARKER

**ACTIVE
SAFETY**


OSAS



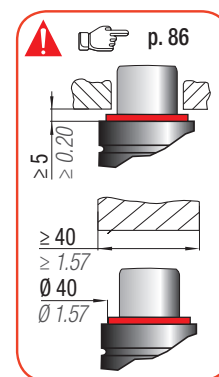
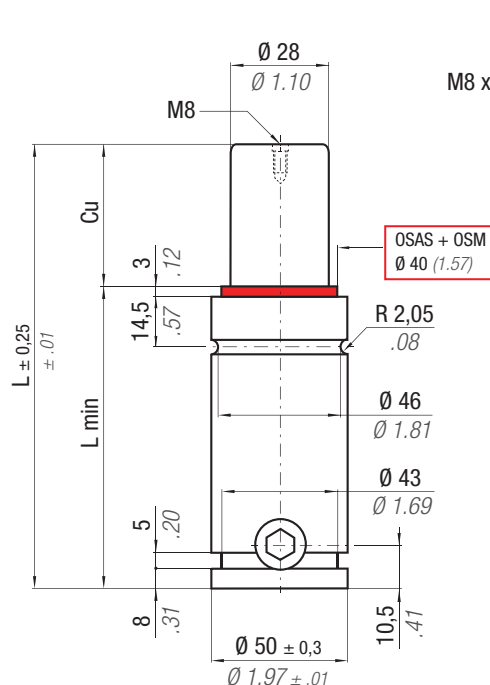
USAS



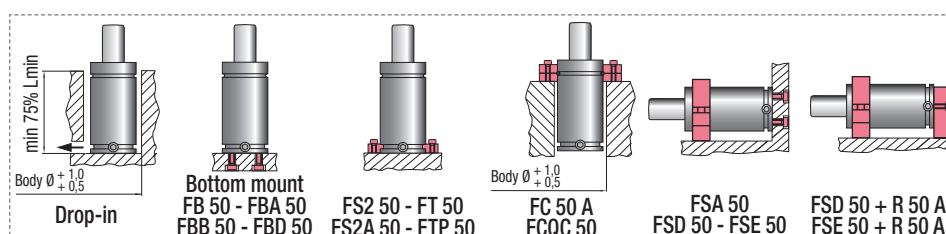
OPAS

* F_{1i} =
 Isothermal
end force at 100% Cu


p. 18

** F_{1p} =
 Polytrophic
end force at 100% Cu


 N ₂		°F 32 176 °C 0 80	ΔP		P max 170 bar 2465 psi		P min 20 bar 290 psi		S 6,15 cm ² 0.953 in ²		SPM ~ 20 - 100 (at 20°C)		Max Speed 1,8 m/s		Maintenance kit 39BMRV01000C			
CODE		Cu		L		L min		Fo Initial force		F _{1i} * End force		F _{1p} ** End force		Vo				PED 2014/68/EU
		mm	inch	mm	inch	mm	inch	daN	lb	daN	lb	daN	lb	cm ³	in ³	~Kg	~lb	
RF 1200 - 013 - A		13	0.51	74	2.91	61	2.40	1060 ± 5% 170 bar 2465 psi + 20 °C +68 °F		1553	3490	1802	4052	29,0	1.77	0,65	1.43	✓
RF 1200 - 016 - A		16	0.63	80	3.15	64	2.52			1597	3591	1869	4202	34,0	2.07	0,68	1.50	✓
RF 1200 - 019 - A		19	0.75	86	3.39	67	2.64			1633	3671	1922	4321	39,0	2.38	0,70	1.54	✓
RF 1200 - 025 - A		25	0.98	98	3.86	73	2.87			1685	3789	2001	4500	48,0	2.93	0,75	1.65	✓
RF 1200 - 032 - A		32	1.26	112	4.41	80	3.15			1728	3884	2066	4644	59,0	3.60	0,81	1.79	✓
RF 1200 - 038 - A		38	1.50	124	4.88	86	3.39			1754	3943	2106	4735	69,0	4.21	0,85	1.87	✓
RF 1200 - 050 - A		50	1.97	148	5.83	98	3.86			1791	4026	2163	4863	88,0	5.37	0,95	2.09	✓
RF 1200 - 063 - A		63	2.48	174	6.85	111	4.37			1817	4085	2204	4954	108,0	6.59	1,05	2.31	✓
RF 1200 - 075 - A		75	2.95	198	7.80	123	4.84			1834	4124	2230	5013	127,0	7.75	1,15	2.54	✓
RF 1200 - 080 - A		80	3.15	208	8.19	128	5.04			1840	4137	2239	5033	135,0	8.24	1,19	2.62	✓
RF 1200 - 100 - A		100	3.94	248	9.76	148	5.83			1858	4177	2267	5096	166,0	10.13	1,35	2.98	✓
RF 1200 - 125 - A		125	4.92	298	11.73	173	6.81			1873	4210	2290	5148	205,0	12.51	1,55	3.42	✓


HOW TO ORDER

INSTALLATION GUIDELINE
