

RS 2400

OSAS + OSM = OVER STROKE ACTIVE SAFETY + OVER STROKE MARKER

ACTIVE SAFETY

easu MANIFOLD

p. 241



OSAS



USAS



OPAS








SKUDO

* F_{1i} =Isothermal
end force
at 100% Cu


p. 18

** F_{1p} =Polytropic
end force
at 100% Cu

NOT FOR

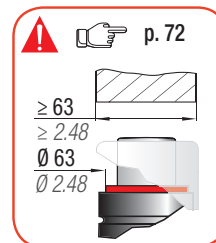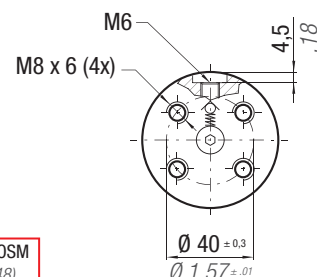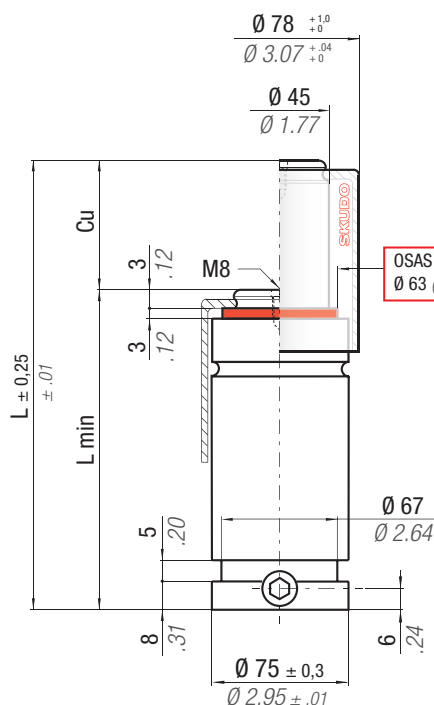

 N2		 °F 32 - 176		 °C 0 - 80		ΔP ± 0,33 %/°C		P max 150 bar 2175 psi		P min 20 bar 290 psi		S 15,90 cm² 2.465 in²		SPM ~ 20 - 100 (at 20°C)		Max Speed 1,8 m/s		Maintenance kit 39BMRV02400D			
CODE				Cu		L		L min		F0		F1i *		F1p **		Vo					
		mm	inch	mm	inch	mm	inch	daN	lb	daN	lb	daN	lb	cm³	in³	~Kg	~lb	2014/68/EU			
RS 2400 - 013 - A		13	0.51	77	3.03	64	2.52	2385 ± 5%	5362	150 bar 2175 psi		3220	7238	3718	8358	93,0	5.67	1,36	3,00	✓	
RS 2400 - 016 - A		16	0.63	83	3.27	67	2.64					3320	7465	3873	8707	105,0	6.41	1,40	3,09	✓	
RS 2400 - 022 - A		22	0.87	95	3.74	73	2.87					3476	7814	4115	9251	129,0	7.87	1,50	3,31	✓	
RS 2400 - 029 - A		29	1.14	109	4.29	80	3.15					3606	8107	4322	9716	157,0	9.58	1,61	3,55	✓	
RS 2400 - 035 - A		35	1.38	121	4.76	86	3.39					3690	8296	4456	10017	181,0	11.04	1,70	3,75	✓	
RS 2400 - 047 - A		47	1.85	145	5.71	98	3.86	+ 20 °C +68 °F				3811	8568	4651	10456	230,0	14.03	1,89	4,17	✓	
RS 2400 - 060 - A		60	2.36	171	6.73	111	4.37					3900	8768	4796	10782	282,0	17.20	2,09	4,61	✓	
RS 2400 - 072 - A		72	2.83	195	7.68	123	4.84					3959	8900	4892	10998	330,0	20.13	2,28	5,03	✓	
RS 2400 - 077 - A		77	3.03	205	8.07	128	5.04					3979	8946	4925	11072	350,0	21.35	2,36	5,20	✓	
RS 2400 - 097 - A		97	3.82	245	9.65	148	5.83					4042	9087	5029	11306	431,0	26.29	2,67	5,89	✓	
RS 2400 - 122 - A		122	4.80	295	11.61	173	6.81					4096	9207	5117	11503	532,0	32.45	3,07	6,77	✓	

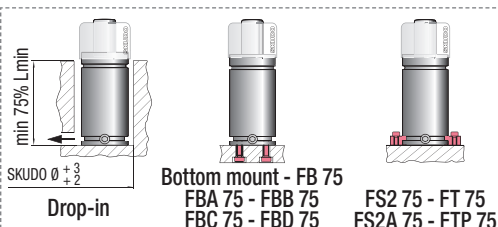WARNING
REMOVE SKUDOUpside down
mounting

HOW TO ORDER



INSTALLATION GUIDELINE

