


## A - FW

### BLOCK CYLINDER

Special Sizes Available On Request.

3D Insertion Reference

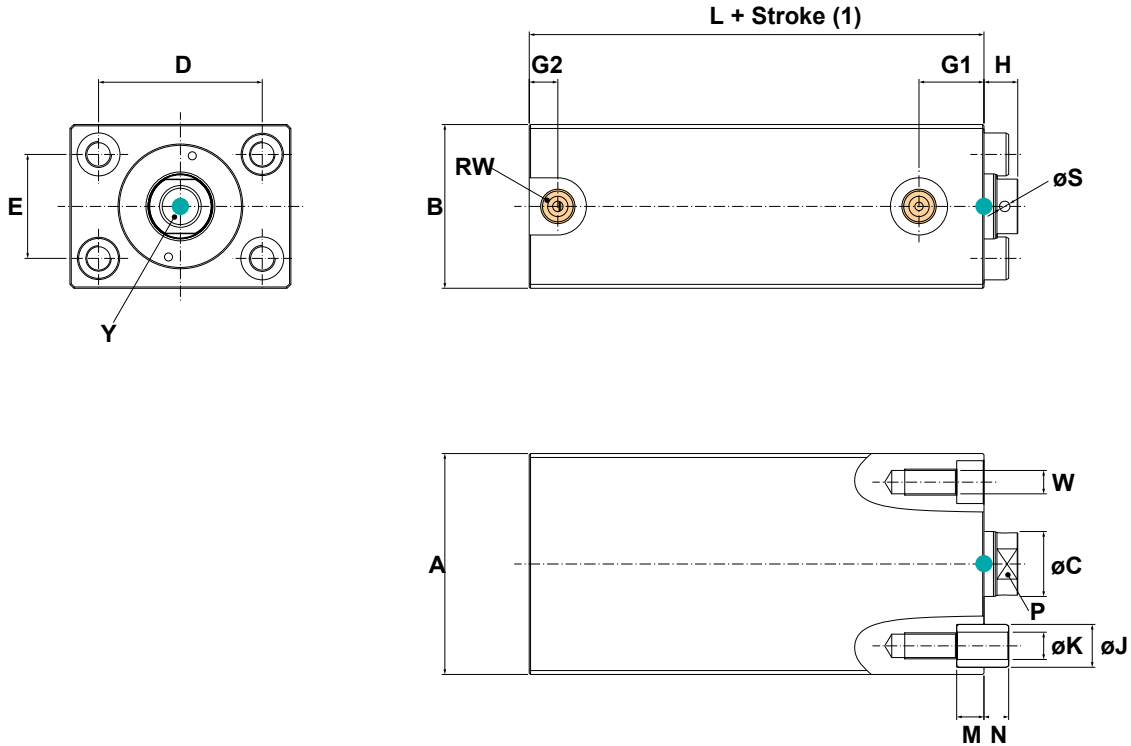

#### HOW TO ORDER

Reference: **A0CW025-090P2S1**

TYPE	OPERATION MODE	FIXATION	PI-STON $\varnothing$	STROKE $\pm 0.5$ (1)		PURGE (2)	SEN-SOR (2)	OIL CONNECTION (3)	A	B	C	D	
				MIN.	MAX.								
A	0	FW	016	010	100	P0	S0	L	60	35	10	40	
			025	010	120				65	45	16	50	
			032	010	150				75	55	20	55	
			040	020	160				85	63	25	63	
			050	020	180	Px	Sx		R	100	75	32	76
			063	020	180					125	95	40	95
			080	020	180					160	120	50	120
			100	020	180					200	150	60	158

STROKE (1) Can be ordered in multiples of 10mm, between Min. and Max. values.

PURGE / SENSOR(2) Replace x by FACE number.


OIL CONNECTION (3) Select Left (L) or Right (R).

## A - FW FIXING STYLE

Special Sizes Available On Request.

3D Insertion Reference

### PURGE / SENSOR (2) POSITION ORDERING

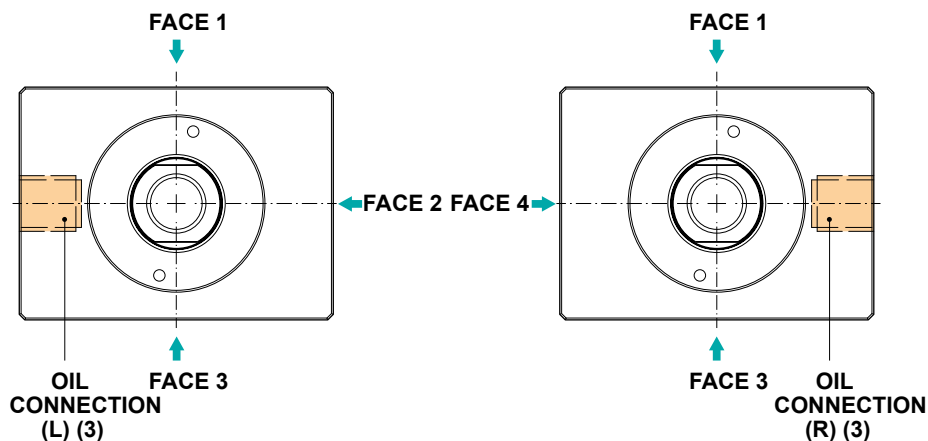

**P0:** Without Purge  
**Px:** Purge in FACE x  
Replace x by FACE number

### SENSOR AND SENSOR ASSEMBLY KIT MUST BE ORDERED SEPARATELY

**S0:** Without Sensor  
**Sx:** Sensor in FACE x  
Replace x by FACE number

F1 (4)	F2 (5)	G1	G2	H ±0.5	J	K	L	M	N	P	RW	S	W	Y
30 (3)	27.5	18	15	8	10.5	6.5	43	6.5	5.5	8	1/4"	-	M6x12	M6x12
33	30	20	13	10	13.5	8.5	48	8.5	7.5	13	1/4"	3	M8x16	M10x15
38 (3)	28	23	11	12	16.5	10.5	51	10.5	9.5	17	1/4"	4	M10x20	M12x15
40	28	25	11	13	16.5	10.5	55	10.5	9.5	21	1/4"	4	M10x20	M16x25
44	30	27	13	14	18.5	13	65	13	11	26	1/4"	5	M12x25	M20x30
50	41	28	16	18	25	17	72	17	15	32	1/2"	5	M16x32	M24x35
60	46	37	17	22	31	21	84	21	19	41	1/2"	5	M20x40	M30x50
64	54	40	20	22	37	25	90	25	23	52	1/2"	5	M24x50	M36x60

(4) PISTON Ø16 & Stroke=10 F1 = 28  
PISTON Ø32 & Stroke=10 F1 = 36

(5) PISTON Ø16 & Stroke ≤ 70 F2 = -  
PISTON Ø25, Ø32, Ø40, Ø50, Ø63, Ø80, Ø100 & Stroke ≤ 90 F2 = -