


Special Sizes Available On Request.

● Cad Insertion Point

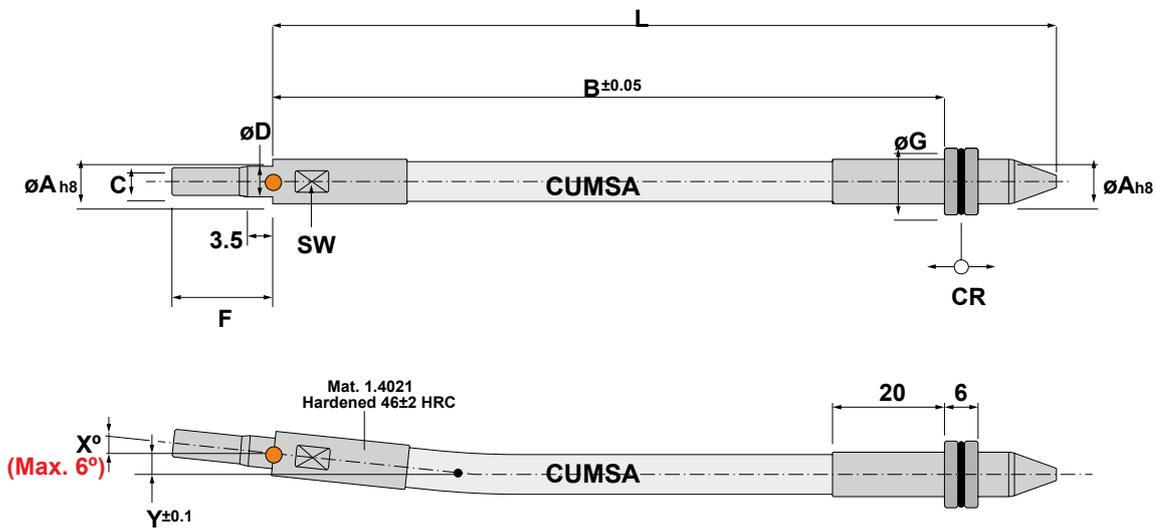



Ref.	A	B	C	D	F	G	L	Z	CR (N)	Max. Stroke	Max. Torque
WP.060030	6	90	M4	4.5	12	10	108	30	1.000	30	8N/m
WP.060060	6	120	M4	4.5	12	10	138	35	1.000	60	8N/m
WP.080030	8	90	M5	5.5	18	12	110	30	1.500	30	12N/m
WP.080060	8	120	M5	5.5	18	12	140	35	1.500	60	12N/m

Special Sizes Available On Request.

● Cad Insertion Point

Installation Guidelines

IMPORTANT! Design a Mechanical Stopper on the insert.

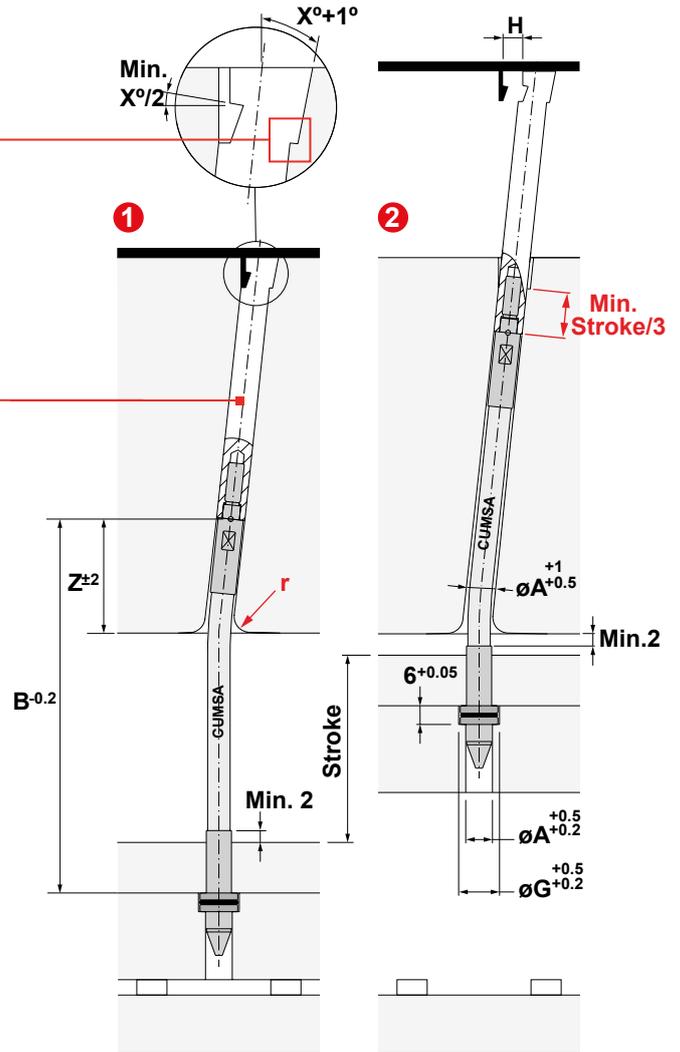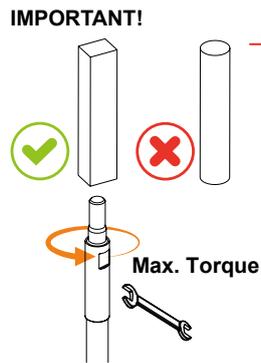

X°	Y	WP.xx0030	WP.xx0060
		H	H
1°	0.60	0.52	1.04
2°	1.20	1.05	2.09
3°	1.80	1.57	3.14
4°	2.40	2.10	4.19
5°	3.00	2.63	5.25
Max. 6°	3.50	3.15	6.31